



## Maintenance newsletter


Dear dealers,

here are some changes in basic maintenance to protect problems with broken studs.

stud bolts M8x25 (13S-00-41) must be torqued to 17Nm

stud bolts M6x25 (13S-00-40) must be torqued to 12Nm

Studs must be checked after each 25 hours.

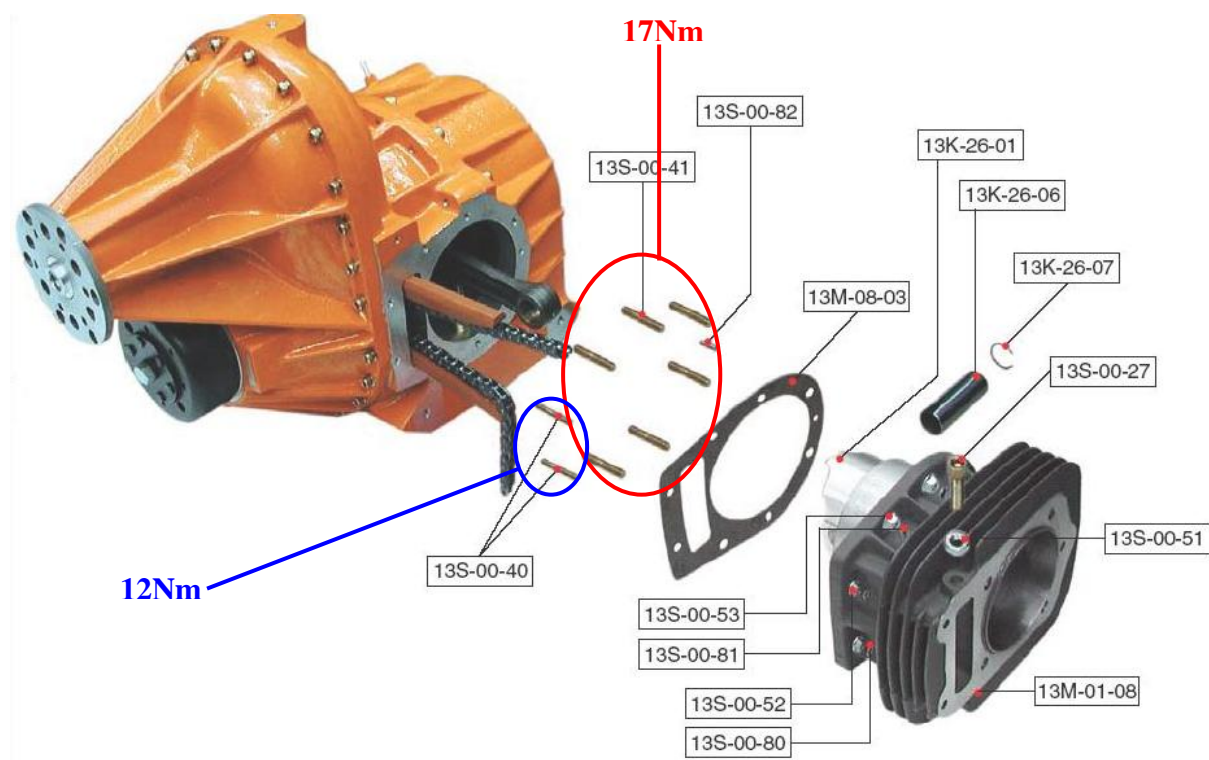

Oil filter:

It is forbidden to use oil filters with oil bypass.

All changes are obligatory.

In Šumperk 19.1.2006

Verner Motor